व्यावसायिक परीक्षण रिपोर्ट (प्रारंभिक) COMMERCIAL TEST REPORT (Initial)



संख्या/No.: LD/NERFMTTI, B. Chariali/

2025-26/01/535

माह / Month: June 2025

THIS TEST REPORT IS VALID UPTO 30.06.2032



SWAN AGRO, NSML DT 175, ROTAVATOR



भारत सरकार

GOVERNMENT OF INDIA

कृषि एवं किसान कल्याण मंत्रालय

MINISTRY OF AGRICULTURE AND FARMERS WELFARE

कृषि एवं किसान कल्याण विभाग

DEPARTMENT OF AGRICULTURE AND FARMERS WELFARE

उत्तर पूर्वी क्षेत्र कृषि यंत्र प्रशिक्षण एवं परीक्षण संस्थान

NORTH EASTERN REGION FARM MACHINERY TRAINING & TESTING INSTITUTE

बिश्वनाथ चारिआलि, जिला - बिश्वनाथ(असम)

BISWANATH CHARIALI, DIST- BISWANATH, ASSAM, PIN - 784 176

[AN ISO 9001:2015 CERTIFIED INSTITUTION]

Ph. No. 03715-222094

Website: https://nerfmtti.nic.in E-mail: fmti-ner@nic.in

LD/NERFMTTI, B. Chariali/ 2025-26/01/535

SWAN AGRO, NSML DT 175 ROTAVATOR

COMMERCIAL (INITIAL)

Name and address of the applicant

: New Swan Multitech Ltd.

Vill. Raian, P.O. Heeran, Kohara-Machiwara Road,

Ludhiana, Punjab Pin - 141 112

Name of machine

: Rotary Tiller (Rotavator) Type : Multi speed, Gear drive, Centrally mounted

Make Model

SWAN AGRO

Year of manufacture

: NSML DT 175

Serial Number

: 2025

Recommended power source, hp

: 1051262

Type of blade

: Tractor -35 hp & above

Size (cm) {Rotor Dia.× Working

: Hatchet (L-Shaped)

: 46 x 177

width}

4.2 **Prime Mover Used:**

Tractor : SWARAJ 855 FE

Chassis No. : QUCL61618127164 Engine No. 47.1402/SML5041

Max. PTO Power, kW : 41.0



4.3 Constructional Details (Refer Fig.1):

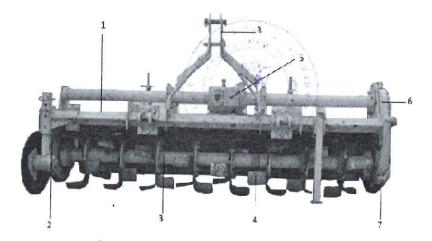


Fig.1: ROTARY TILLER (ROTAVATOR)

KEYWORDS:

- Mainframe 1.
- 2. Side plate
- Rotor shaft 3.
- Rotor blade

4.3.1 Main Frame:

Type

- Primary reduction gear box
- Secondary reduction gear box
- 7. Skid
- Hitch pyramid
- : Fabricated from MS sheet, MS square pipe and MS Plate.

Road,

owing

was

and

25

6. RUNNING -IN

One hour of machine Running-in was recommended by the applicant. Hence, the machine was run-in for one hour in actual field condition before the actual test. All the fasteners were checked and tightened thereafter.

7. FIELD PERFORMANCE TEST

The field test of the rotavator comprising of wet land and dry land operations were conducted for 10.30 and 25.87 hours, respectively to assess the performance of the machine. The field performance of the rotavator is reported in Annexure-I & II for wet land and dry land operations, respectively. The tractor was operated at standard PTO speed (540 ± 10) and observations are summarized in the following Table.

Summary of Field Performance Test

Sr. No.	Parameters/operations	Wet land operation (Puddling)	Dry land operation	
1	Gear Used	L-2	L-2	
2	Engine speed (rpm)			
	No load	1800 to 1820	1805 to 1811	
	On load	1740 to 1760	1744 to 1754	
3	Type of soil	Li	ight	
4	Depth of standing water (cm)/ soil moisture (%)	10.10 to 10.24	11.75 to 13.60	
5	Bulk density of soil (g/cc)		1.49 to 1.66	
6	Speed of operation (kmph)	2.17 to 2.21	2.88 to 2.99	
7	Travel reduction (%)/ Wheel slip (%)	-2.33 to -3.23	-1.14 to -1.45	
8	Depth of puddle (cm)/ Depth of cut (cm)	28.22 to 28.60	10.03 to 10.15	
9	Working width (cm)		181 to 183	
10	Area covered (ha/h)	0.43 to 0.45	0.43 to 0.47	
11	Time required for one ha (h)	2.31 to 2.24	2.13 to 2.29	
12	Puddling Index (%)/ Field efficiency (%)	89.60 to 89.90	80.61 to 87.41	
13	Power requirement (kW)	NR	21.33 to 22.50	
14	Fuel consumption			
	ाज पासमा 1/h	4.0 to 4.2	5.25 to 5.75	
	I/ha	8.96 to 9.70	11.49 to 12.66	

FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032]

Page 15 of 25

orm

orm

on

. The

SWAN AGRO, NSML DT 175	COMMERCIAL
ROTAVATOR	(INITIAL)

7.1 Wet land operation:

The tractor was operated without cage wheel for puddling operation of rotary tiller (rotavator).

7.1.1 Quality of work:

- a) The depth of puddle was recorded as 28.22 to 28.60 cm.
- b) The puddling index was recorded as 89.60 to 89.90 %.

7.2 Dry land operation:

7.2.1 Rate of work:

- (a) The rate of work was recorded as 0.43 to 0.47 ha/h and the speed of operation were recorded as 2.88 to 2.99 kmph.
- (b) The time required to cover one hectare was recorded as 2.13 to 2.29 h.

7.2.2 Quality of work:

- (a) The depth of cut was recorded as 10.03 to 10.15 cm.
- (b) Working width was observed as 181 to 183 cm.
- (c) Field efficiency was observed as 80.61 to 87.41 %.

7.3 Effectiveness of sealing for wet land operation:

After completion of field test in wet land, the rotavator was dismantled for checking the effectiveness of sealing provided against ingress of mud and/or water in various sub-assemblies/components. The observations are given in ensuing Table:

Sr.	Location	Whether ingress of mud and/or water
No.		was observed (Yes/No)
1	Primary reduction gear box	No
2	Secondary reduction gear box	No
3	Rotor axle bearing cap	No

7.4 Labour requirement:

One skilled operator is needed to operate the tractor with the rotavator.

7.5 Adequacy of power of prime mover as used during test:

The power of the prime mover as used during test was found adequate.

7.6 Wear analysis:

7.6.1 On mass basis:

Wear analysis on mass basis was done after 36.17 hours (wet land & dry land operation) and the results are as shown below,



FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032]

Page 16 of 25

LD/NERFMTTI, B. Chariali/	SWAN AGRO, NSML DT 175	COMMERCIAL
2025-26/01/535	ROTAVATOR	(INITIAL)

	After wet land and dry land operation						
Sr.	Initial Mass	Final Mass	Percentage of wear				
No.	(g)	(g)	After 36.17 hours	Per Hour			
1	1017.0	851.0	16.32	0.45			
2	1078.0	959.0	11.04	0.31			
3	1061.0	940.0	11.40	0.32			
4	1058.0	926.0	12.48	0.34			
5	1068.0	954.0	10.67	0.30			
6	1067.0	944.0	13.03	0.32			
7	1012.0	908.0	10.28	0.28			
8	1072.0	894.0	16.60	0.46			

The hourly rate of wear of blade on mass basis after wet land and dry land operations was recorded as 0.28 to 0.46 %.



FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06,2032]

Page 17 of 25

COMMERCIAL (INITIAL)

Page 19 of 25

FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM (AN 18O 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032)

LD/NERFMTTI, B. Chariali/

2025-26/01/535

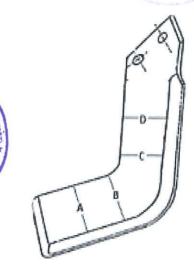


Fig. 7 DIMENSIONS OF BLADE FOR WEAR ANALYSIS

8. EASE OF OPERATION AND ADJUSTMENTS

The operator can easily adjust and control the rotavator from operator's seat in the field as the adjustments are within the easy reach of operator. However, the operator has to get down from the tractor in order to raise/lower the depth adjusting skids.

9. DEFECTS, BREAKDOWNS AND REPAIRS

No breakdown was occurred during 36.17 hours of field performance test (wet land and dry land operation).

10. PARAMETERS APPLICABLE FOR QUALIFYING MINIMUM PERFORMANCE CRITERIA

Sr. No.	Characteristics	Category Evaluative/ Non Evaluative	Requirement	Tolerance	As Observed	Whether meets the requiremen ts (Yes/ No)
1	2	3	4	5	6	7
1	Field Performance					
i	Suitability for wet land operation	Evaluative	Should be suitable for wet land operation		Suitable	Yes
ii	Depth of cut in dry land operation (cm)	Evaluative	Minimum 10 cm	-	10.03 to 10.15	Yes
iii	Depth of puddle in wet land operation(cm)	Evaluative	Minimum 12 cm		28.22 to 28.86	Yes
iv	Field Efficiency (%)	Evaluative	Minimum 75 %		80.61 to 87.41	Yes

FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032]



			0.02	00	0.1	0.1	0.01	0.1	00	05	0.01
		L									
	Per hour	C	0.35	0.34	0.18	0.15	0.17	0.15	0.12	0.46	0 24
	Per	В	0.52	0.42	0.45	0.47	0.42	0.45	0.43	0.57	710
e wear		A	0.61	0.47	0.45	0.53	0.47	0.50	0.44	0.63	0 51 0 17
Percentage wear		D	0.81	0.15	0.43	0.19	0.28	0.28	0.14	1.70	America
Pel	7 hour	C	12.5	12.28	6.41	5.53	6.05	5.51	4.37	16.78	A
	After 36.17 hour	В	18.66	15.22	16.45	17	15.20	16.21	15.70	20.73	
	A	A	22.15	16.82	16.13	19.02	17.03	17.93		22.68	
		D	82.23	83.82	83.30	83.25	83.82	83.82	82.3	83.75	
iter end	lı.	S	71.48	73.54	77.8		78.71	77.67	6.82	70.30	
Blade width at every 50 mm from outer end	Final	В	67.56	71.1	69.33	09:69	71.11	70.92	69.85	67.14	
ry 50 mn		A	61.47	66.42	66.15	64.80	66.82	66.54	65.81	61.67	
Ith at eve		D	83.04	83.95	83.66	83.41	84.06	84.60	82.42	85.20	
slade wid	ial	C	83.98	83.84	83.13	83.52	83.78	84.43	82.51	84.48	
щ	Initia	В	83.06	83.87	82.98	83.86	83.86	84.64	82.86	84.70	
		A	78.96	79.85	78.87	80.02	80.54	81.08	78.24	79.76	
Sr.	No.	•	1	7	3	4	5	9	7	∞	

The hourly rate of wear of blade on dimensional basis after wet land and dry land operations was recorded as 0.01 to 0.51%.

LD/NERFMTTI, B. Chariali/ 2025-26/01/535

SWAN AGRO, NSML DT 175 ROTAVATOR

COMMERCIAL (INITIAL)

1	2	3	4	5	6	7
v	Puddling Index (%)	Evaluative	Minimum 65 %		89.60 to 89.90	Yes
2	Safety Requireme	nts		10	() - () - () ·	
i	Safety considerations	Evaluative	Should meet the requirement of IS:10740 and IS:10318		Provided	Yes
ii	Safety Clutch/ device(shear bolt) in PTO drive shaft	Evaluative	Should be provided	-/2	Provided	Yes
iii	Rotavator Stand	Evaluative	Should be provided		Provided	Yes
iv	Rotavator shield to prevent flying of mud and stone	Evaluative	Should be provided	-	Provided	Yes
v	Guard over propeller shaft	Evaluative	Should be provided		Provided	Yes
3	Effectiveness of sea	aling (presence of i	ngress of dust and w	ater/ mud in v	arious sub-assemblies)	
i	Primary reduction gear/ box	Evaluative	No ingress of mud and water		No ingress of mud and water	Yes
ii	Secondary reduction gear/box	Evaluative	No ingress of mud and water		No ingress of mud and water	Yes
iii	Rotary axle bearing cap	Evaluative	No ingress of mud and water		No ingress of mud and water	Yes
4	Material of constru	iction				
i	Hardness of blades	Evaluative	High carbon steel, boron steel		Does not conform	No
ii	Chemical composition of rotor blades	Evaluative	As per IS:6690		Does not conform	No
5	Dimensional requir	ements				
i	Dimension of three point linkage	Non-Evaluative	Should meet IS:4468 (part -I)		Does not conform	No
ii	Dimension of PIC of Implements	Non-Evaluative	Should meet IS:4931		Does not conform	No
iii	Dimensions of PIC yoke bore	Non-Evaluative	Should meet IS:4931		Conforms	Yes
6	Literature (Submis	sion to test agency)				
i	Operator cum service manual and part catalogue	Evaluative	Should be provided as per IS:8132		Provided	Yes
7		tor (provision of la		ntioned below	and should be welded o	n rotary
	Parameter					
i	Name and address of the manufacturer				Provided	Yes
ii	Make				Provided	Yes
iii	Model		<u> </u>		Provided	Yes
iv	Size, (m) {Dia of Rotor X Width of Cut}	Evaluative	Should be provided on rotary tiller	-	Provided	Yes
v	Country of origin		(Rotavator)		Provided	Yes
vi	Year of manufacture				Provided	Yes

FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032]

Page 20 of 25

LD/NERFMTTI, B. Chariali/ 2025-26/01/535

SWAN AGRO, NSML DT 175 ROTAVATOR

COMMERCIAL (INITIAL)

1	2	3	4	5	6	7
vii	Chassis Serial Number				Provided	Yes
viii	Recommended PTO speed of Prime mover(rpm)				Provided	Yes
ix	Maximum PTO power requirement, kW				Provided	Yes
8	Category of Break	downs/ Defects				
	Category of breakdowns	Category Evaluative/ Non Evaluative	Requirements		As Observed	Whether meets the requiremen s (Yes/ No)
i	Critical breakdown	Evaluative	No critical breakdown		None	Yes
ii	Major breakdown	Evaluative	Not more than one and neither of them should be repetitive in nature.		None	Yes
iii	Minor breakdowns	Evaluative	Not more than three and frequency of each should not be more than two.		None	Yes
iv	Total breakdowns	Evaluative	In no case, the total no of breakdown should exceed four, i.e. (1 major + 3 minor) or 4 minor breakdowns		None	Yes





FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032]

Page 21 of 25

LD/NERFMTTI, B. Chariali/	SWAN AGRO, NSML DT 175	COMMERCIAL
2025-26/01/535	ROTAVATOR	(INITIAL)

11. <u>CRITICAL TECHNICAL SPECIFICATIONS</u>
(Vide Ministry's letter No. 13-9/2019-(M&T) (I&P)-Part dated 26.04.2019)

Sr. No.	Parameters	Specifications	Observation	Remarks
1	2	3	4	5
1	Working width (mm)	1200 (Min.)	1770	Conforms
2	Type of blade	C/L/J shape as per demand	L - Shape	Conforms
3	Blade overlap, mm	15 (Min.)	15.2	Conforms
4	Thickness of blade (mm)	7-8 (Min.)	7.10	Conforms
5	No. of Blades	30 (Min.)	42	Conforms
6	Total number of flange	5 (Min.)	8	Conforms
7	Number of blades per flange	1 /	6	Conforms
8	Outer Diameter of rotor shaft, mm		73.5	Does not conform
9	Rotor diameter, including flange and blade mounted on flange, mm		460	Conforms
10	Side Drive	Gear drive	Gear drive	Conforms
11	Depth control mechanism	Arc shaped skid on both side of rotavator	Provided	Conforms
12	Material of blades	Boron (28MnCrB5) / High Carbon Steel EN42)	Boron (28MnCrB5)	Conforms
13	Hardness of Blade Material, HRC	38 (Min.)	42	Conforms
14	Safety clutch / device (Shear bolt) in PTO drive shaft	Must be provided	Provided	Conforms
15	Rotavator stand	Must be provided	Provided	Conforms
16	Guard over propeller shaft	Must be provided	Provided	Conforms
17	Sheet metal	AS36 / IS 2062	As per IS 2062	Conforms
18	Marking/labeling of machine	The labeling plate should be riveted on the body of machine having Name and address of manufacturer, Country of origin, Make, Model, Year of manufacturer, Serial	Provided	Conforms
	The north Change Branch Change The Change Branch Change Br	number, Type, Size, required size of prime mover (kW)		

FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM
[AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032)

Page 22 of 25

LD/NERFMTTI, B. Chariali/	SWAN AGRO, NSML DT 175	COMMERCIAL
2025-26/01/535	ROTAVATOR	(INITIAL)

1 2		2 3		5	
19	Literature	Operator manual, Service manual and Part catalogue should be provided.	Provided	Conforms	

12. COMMENTS AND RECOMMENDATIONS

- 12.1 Dimensions of Three point linkage of the rotavator does not conform to IS: 4468-1997 (Part-1) and it should be looked into for corrective action.
- 12.2 Dimensions of PIC of the rotavator does not conform to IS: 4931-1995 and it should be looked into for corrective action.
- 12.3 The hardness and chemical composition of rotary blades does not conform to the requirement of IS 6690:1981 (Reaffirmed 2022). This may be looked into for corrective action.
- 12.4 The outer diameter of rotor shaft does not conform to critical technical specifications vide Ministry's letter No. 13-9/2019-(M&T) (I&P)-Part dated 26.04.2019. This should be looked into for corrective action.

TESTING AUTHORITY

(M.R. PATIL)
SENIOR AGRICULTURAL ENGINEER

(P. KAMALABAI) DIRECTOR



Draft test report compiled by - Shri D. Deori, Technical Assistant

13. APPLICANT'S COMMENTS

Para No.	Our Reference	Applicants Comments				
13.1	12.1	For further production we shall take appropriate action to improve the same as per IS: 4468-1997 in future.				
13.2	12.2	For further production we shall take appropriate action to improve the same as per IS: 4931-1995 in future.				
13.3	12.3	We will try to improve material & Hardness.				
13.4	12.4	For further production we shall take appropriate action for Dia. of rotor shaft.				

FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032]

Page 23 of 25

LD/NERFMTTI, B. Chariali/
2025-26/01/535

SWAN AGRO, NSML DT 175 ROTAVATOR

COMMERCIAL (INITIAL)

ANNEXURE-I

FIELD PERFORMANCE RESULTS (WET LAND OPERATION)

Place of test: Village-Raina, Dist.- Ludhiana, Punjab

Tractor used: SWARAJ 855

Sr. No.	Parameters	Test trails		Avg.	
	*	I	II		
1	Date of test	23.06.2025	23.06.2025		
2	Net test duration (h)	5.25	5.25		
3	Gear used		L-2		
4	Engine speed (rpm)				
	No load	1811	1810	1810	
	On load	1751	1750	1750	
5	Type of Soil	Medium		m	
6	Av. depth of standing water (cm)	10.24	10.10	10.17	
7	Previous treatment	1	Nil		
8	Forward speed (kmph)	2.21	2.17	2.19	
9	Av. travel reduction (%)	-2.33	-3.23	-2.78	
10	Av. wheel sinkage (cm)	32.34	32.94	32.64	
11	Av. depth of puddle (cm)	28.22	28.86	28.54	
12	Water over puddle (cm)	4.12	4.08	4.10	
13	Puddling index (%)	89.60	89.90	89.75	
14	Fuel consumption (l/h)	4.0	4.2	4.1	
15	Area covered (ha/h)	0.446	0.432	0.439	
16	Time required for one ha (h)	2.24	2.31	2.27	



FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032]

Page 24 of 25

LD/NERFMTTI, B. Chariali/ 2025-26/01/535 SWAN AGRO, NSML DT 175 ROTAVATOR COMMERCIAL (INITIAL)

ANNEXURE-II

FIELD PERFORMANCE RESULTS (DRY LAND OPERATION)

Place of test: Vill. Kanech, Dist.-Ludhiana, Punjab

Tractor used: SWRAJ 855

Sr.	Parameters	I	II	III	IV	Avg.			
No.	3		100707	20.05.25	21.05.25				
1	Date of test	18.05.25	19.05.25	20.05.25	21.05.25	1 /			
2	Net test duration (h)	7.70	6.76	7.25	4.16				
3	Gear used	used L-2							
4	Engine speed (rpm)								
	No load	1810	1810	1805	1811	1809			
	On load	1754	1744	1745	1745	1747			
5	Furrow length (m)	82	91	93	88	88			
6	Type of soil	Medium							
7	Bulk density (g/cc)	1.66	1.56	1.55	1.44	1.55			
8	Soil Moisture (%)	13.60	11.15	11.78	12.20	12.18			
9	Previous treatment	Nil							
10	Forward speed (kmph)	2.99	2.88	2.94	2.98	2.95			
11	Wheel slippage (%)	-1.14	-1.45	-1.36	-1.29	-1.31			
12	Av. Depth of cut (cm)	10.11	10.15	10.07	10.03	10.09			
13	Av. Width of cut (cm)	183	181	183	181	182			
14	Soil pulverization (cm)	1.11	1.02	1.01	1.36	1.12			
15	Area covered (ha/h)	0.441	0.435	0.470	0.457	0.450			
16	Power requirement (kW)	21.33	22.10	22.20	22.50	22.03			
17	Time required for one ha	2.26	2.29	2.13	2.19	2.22			
	(h)								
18	Field efficiency (%)	80.61	83.06	87.41	84.83	83.98			
19									
	1/h	5.60	5.47	5.75	5.25	5.52			
	l/ha	12.66	12.53	12.25	11.49	12.23			



FARM MACHINERY TRAINING & TESTING INSTITUTE (NER), B. CHARIALI, ASSAM [AN ISO 9001:2015 CERTIFIED INSTITUTION] (THIS TEST REPORT IS VALID UP TO 30.06.2032]

Page 25 of 25